

Manhole Inspection Summary

Manhole # S01QQ_013MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **01QQ** Node: **013** Status: **Found**

Insp Date: **2/26/08 10:53 AM**

Incomplete Comments

Crew: **TJ JK**
Inspector: **Johnson**
Firm: **URS**

Location Address: **4511 FAIRFAX RD**

Cross Street: **LAWINA RD**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Light Rain** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Stormwater** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **D-Shape** Diameter: **48** (in.) Length: **48** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **7** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View



GRADE ADJUSTMENT

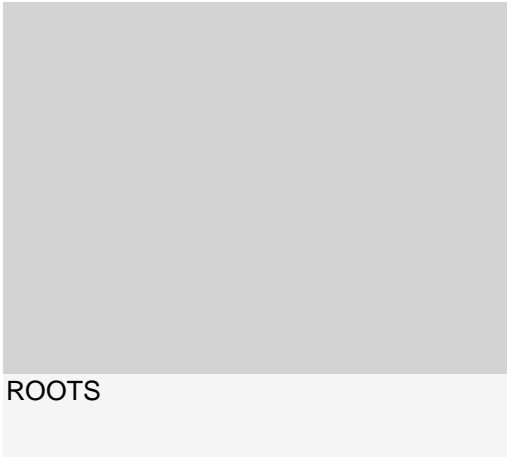


ROOTS

Defect 1



INFILTRATION

Defect 2

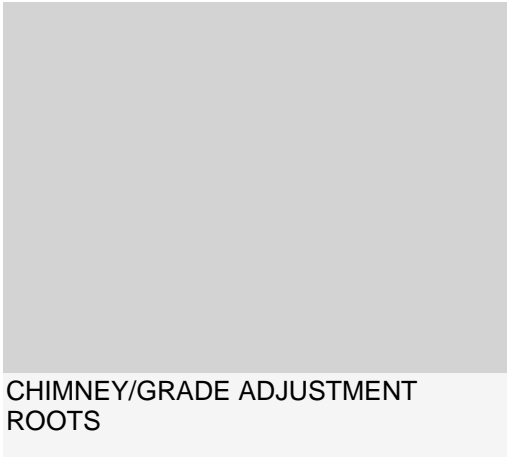

CHIMNEY/GRADE ADJUSTMENT
ROOTS

Manhole Inspection Summary

Manhole # S01QQ_013MH

Printed On: 6/24/2010

Page 3 of 3

15 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



CRACKED PIPE SEAL

Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **13.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **13.42** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection